

UDDEHOLM ORVAR SUPREME

Uddeholm Orvar Supreme can be regarded as an “all-round” steel used in several application areas. Except for hot work application areas the steel is also used in moulds for plastics and as a material in high stressed axles.

The high degree of purity and the very fine structure shows improvement in dies and components where high mechanical and thermal stresses are involved.

This information is based on our present state of knowledge and is intended to provide general notes on our products and their uses. It should not therefore be construed as a warranty of specific properties of the products described or a warranty for fitness for a particular purpose.

Classified according to EU Directive 1999/45/EC

For further information see our “Material Safety Data Sheets”.

Edition 8, 04.2011

The latest revised edition of this brochure is the English version, which is always published on our web site www.uddeholm.com



SS-EN ISO 9001
SS-EN ISO 14001

General

Uddeholm Orvar Supreme is a chromium-molybdenum-vanadium-alloyed steel which is characterized by:

- High level of resistance to thermal shock and thermal fatigue
- Good high-temperature strength
- Excellent toughness and ductility **in all directions**
- Good machinability and polishability
- Excellent through-hardening properties
- Good dimensional stability during hardening

Typical analysis %	C	Si	Mn	Cr	Mo	V
	0.39	1.0	0.4	5.2	1.4	0.9
Standard specification	Premium AISI H13, W.-Nr. 1.2344					
Delivery condition	Soft annealed to approx. 180 HB					
Colour code	Orange					

Improved tooling performance

The name “Supreme” implies that by special processing techniques and close control, the steel attains high purity and a very fine structure. Further, Uddeholm Orvar Supreme shows significant improvements in isotropic properties compared to conventionally produced AISI H 13 grades.

These improved isotropic properties are particularly valuable for tooling subjected to high mechanical and thermal fatigue stresses, e.g. die casting dies, forging tools and extrusion tooling. In practical terms, tools may be used at somewhat higher working hardnesses (+1 to 2 HRC) without loss of toughness. Since increased hardness slows down the formation of heatchecking cracks, improved tool performance can be expected.

Uddeholm Orvar Supreme meets the North American Die Casting Association (NADCA) #207-2008 for **premium** high quality H-13 die steel.

Applications

Tools for die casting


Part	Tin, lead zinc alloys HRC	Aluminium, magnesium alloys, HRC	Copper alloys HRC
Dies	46–50	42–48	(QRO 90 S)
Fixed inserts	46–52	44–48	(QRO 90 S)
cores	48–52	46–48	(QRO 90 S)
Sprue parts	35–42	42–48	(QRO 90 S)
Nozzles			
Ejector pins (nitrided)	46–50	46–50	46–50
Plunger, shot-sleeve (normally nitrided)	42–46	42–48	(QRO 90 S)
Austenitizing temperature	1020–1030°C (1870–1885°F)		1040–1050°C (1900–1920°F)

Tools for extrusion

Part	Aluminium, magnesium alloys, HRC	Copper alloys HRC	Stainless steel HRC
Dies	44–50	43–47	45–50
Backers, die-holders, liners, dummy blocks, stems	41–50	40–48	40–48
Austenitizing temperature (approx.)	1020–1030°C (1870–1885°F)		1040–1050°C (1900–1920°F)

Tools for hot pressing

Material	Aust. temp. (approx.)	HRC
Aluminium, magnesium	1020–1030°C (1870–1885°F)	44–52
Copper alloys	1040–1050°C (1900–1920°F)	44–52
Steel	1040–1050°C (1900–1920°F)	40–50

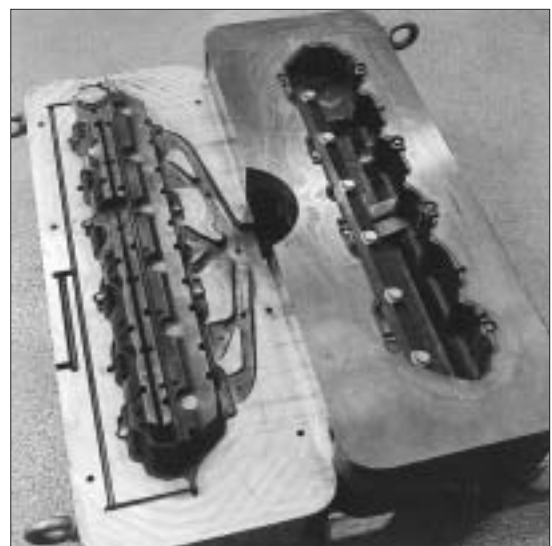

Moulds for plastics

Part	Austenitizing temp.	HRC
Injection moulds Compression/ transfer moulds	1020–1030°C (1870–1885°F) Tempering 1. ≥ 550°C (1020°F) or 2. 250°C (480°F)	40–52 50–53

Other applications

Application	Austenitizing temp.	HRC
Severe cold punching, scrap shears	1020–1030°C (1870–1885°F) Tempering 250°C (480°F)	50–53
Hot shearing	1020–1030°C (1870–1885°F) Tempering 1. 250°C (480°F) or 2. 575–600°C (1070–1110°F)	50–53 45–50
Shrink rings (e.g. for cemented carbide dies)	1020–1030°C (1870–1885°F) Tempering 575–600°C (1070–1110°F)	45–50
Wear-resisting parts	1020–1030°C (1870–1885°F) Tempering 575°C (1070°F) Nitriding	Core 50–52 Surface ~1000HV ₁

Properties

All specimens are taken from the centre of a 407 x 127 mm (16" x 5") bar. Unless otherwise is indicated all specimens were hardened 30 minutes at 1025°C (1875°F), quenched in air and tempered 2 + 2 h at 610°C (1130°F). The hardness were 45 ± 1 HRC.

Physical data

Data at room and elevated temperatures.

Temperature	20°C (68°F)	400°C (750°F)	600°C (1110°F)
Density kg/m ³ lbs/in ³	7800 0.281	7700 0.277	7600 0.274
Modulus of elasticity MPa psi	210 000 30.5 x 10 ⁶	180 000 26.1 x 10 ⁶	140 000 20.3 x 10 ⁶
Coefficient of thermal expansion per °C from 20°C °F from 68°F	– –	12.6 x 10 ⁻⁶ 7.0 x 10 ⁻⁶	13.2 x 10 ⁻⁶ 7.3 x 10 ⁻⁶
Thermal conductivity W/m °C Btu in/(ft ² h°F)	25 176	29 204	30 211


Mechanical properties

Approximate tensile strength at room temperature.


Hardness	52 HRC	45 HRC
Tensile strength R _m	1820 MPa 185 kp/mm ² 117 tsi 263 000 psi	1420 MPa 145 kp/mm ² 92 tsi 206 000 psi
Yield strength R _{p0.2}	1520 MPa 155 kp/mm ² 98 tsi 220 000 psi	1280 MPa 130 kp/mm ² 83 tsi 185 000 psi

APPROXIMATE STRENGTH AT ELEVATED TEMPERATURES

Longitudinal direction.

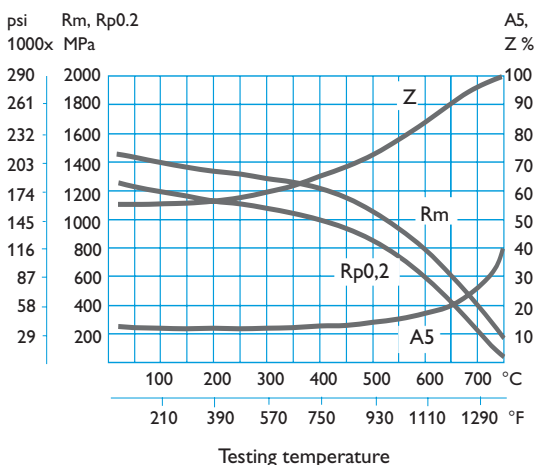


EFFECT OF TIME AT HIGH TEMPERATURES ON HARDNESS

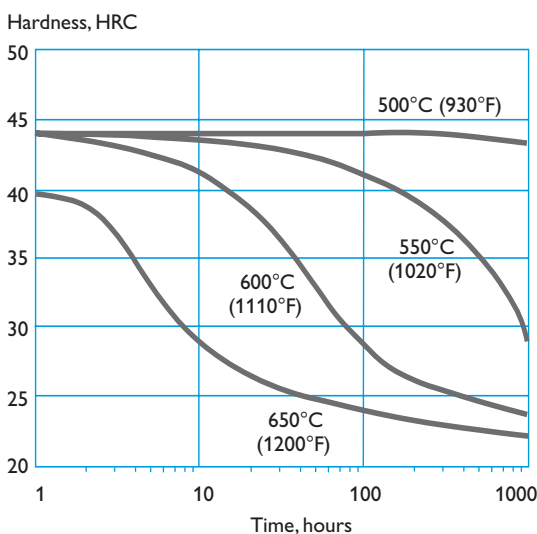

EFFECT OF TESTING TEMPERATURE ON IMPACT ENERGY

Charpy V specimens, short transverse direction.

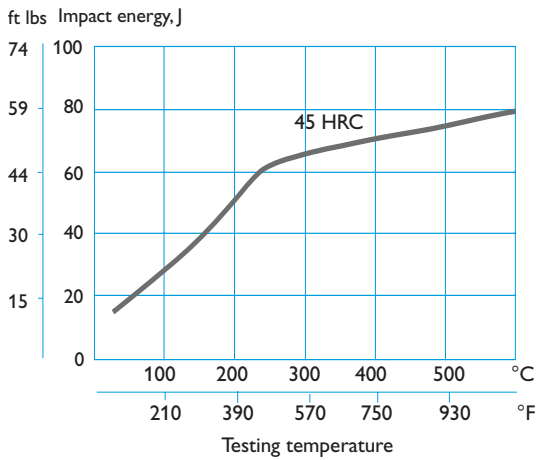

Stress relieving

After rough machining the tool should be heated through to 650°C (1200°F), holding time 2 hours. Cool slowly to 500°C (930°F), then freely in air.

Hardening

Pre-heating temperature: 600–850°C (1110–1560°F), normally in two pre-heating steps.
Austenitizing temperature: 1020–1050°C (1870–1920°F), normally 1020–1030°C (1870–1885°F).

Temperature		Soaking* time minutes	Hardness before tempering
°C	°F		
1025	1875	30	53±2 HRC
1050	1920	15	54±2 HRC

* Soaking time = time at hardening temperature after the tool is fully heated through

Heat treatment—general recommendations


Soft annealing

Protect the steel and heat through to 850°C (1560°F). Then cool in the furnace at 10°C (20°F) per hour to 650°C (1200°F), then freely in air.

Protect the part against decarburization and oxidation during hardening.

CCT GRAPH

Austenitizing temperature 1020°C (1870°F). Holding time 30 minutes.

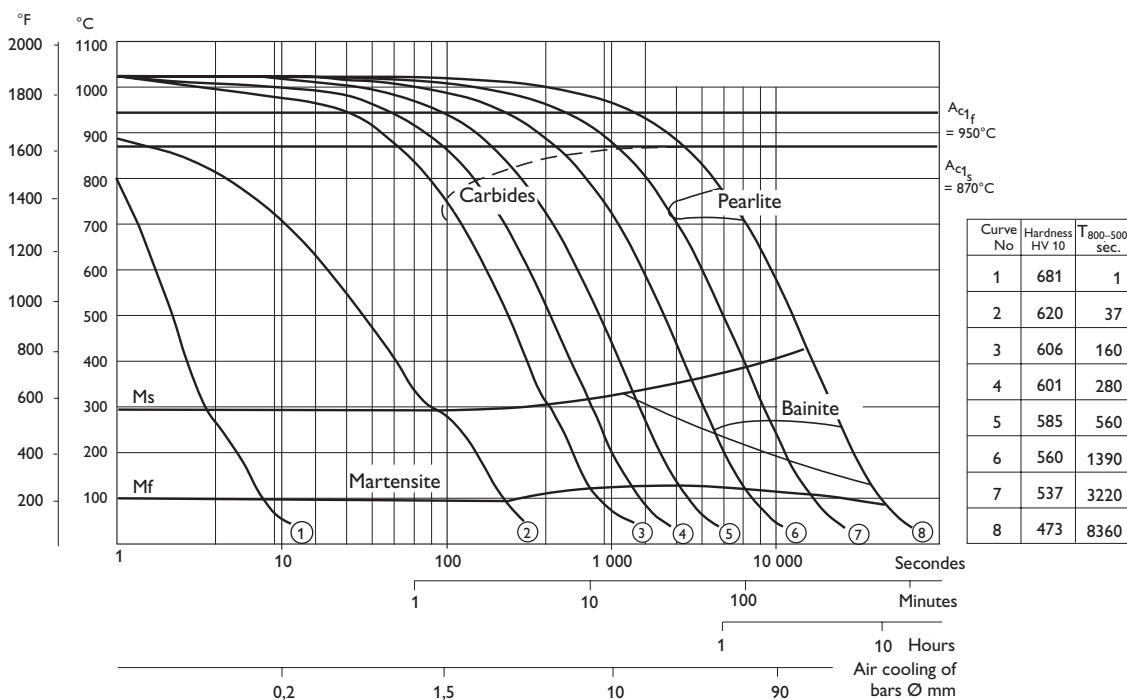


Quenching media

- High speed gas/circulating atmosphere
- Vacuum (high speed gas with sufficient positive pressure). An interrupted quench is recommended where distortion control and quench cracking are a concern
- Martempering bath or fluidized bed at 450–550°C (840–1020°F), then cool in air
- Martempering bath or fluidized bed at approx. 180–220°C (360–430°F) then cool in air
- Warm oil

Note 1: Temper the tool as soon as its temperature reaches 50–70°C (120–160°F).

Note 2: In order to obtain the optimum properties for the tool, the cooling rate should be fast, but not at a level that gives excessive distortion or cracks.

HARDNESS, GRAIN SIZE AND RETAINED AUSTENITE AS FUNCTIONS OF AUSTENITIZING TEMPERATURE


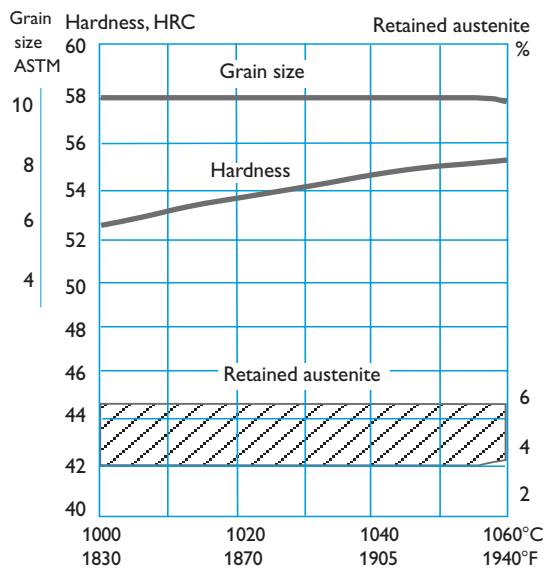


Tempering

Choose the tempering temperature according to the hardness required by reference to the tempering graph. Temper minimum twice with intermediate cooling to room temperature. Lowest tempering temperature 250°C (480°F). Holding time at temperature minimum 2 h.


To avoid “temper brittleness”, do not temper in the range 425–550°C (800–1020°F), see graph.

TEMPERING GRAPH

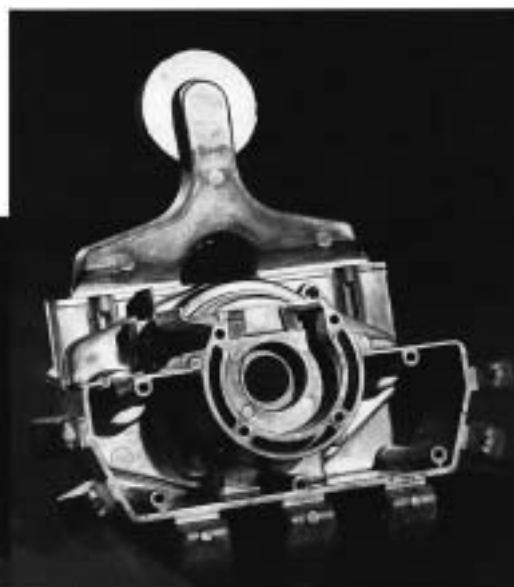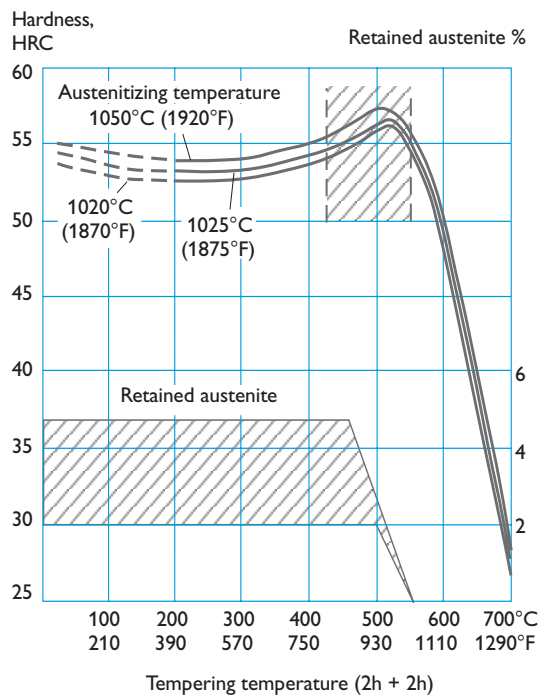

APPROXIMATE IMPACT STRENGTH AT DIFFERENT TEMPERING TEMPERATURES

Charpy V specimens, short transverse direction.

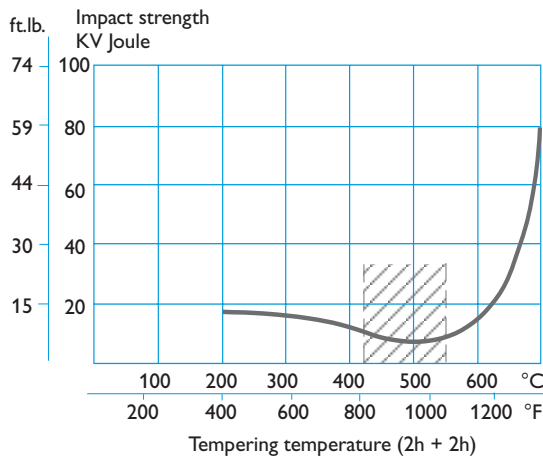


Tempering within the range 425–550°C (800–1020°F) is normally not recommended due to the reduction in toughness properties.

Dimensional changes during hardening

Sample plate, 100 x 100 x 25 mm, 4" x 4" x 1".

	Width %	Length %	Thickness %
Oil hardened from 1020°C (1870°F)	Min. -0.08	-0.06	±0
	Max. -0.15	-0.16	+0.30
Air hardened from 1020°C (1870°F)	Min. -0.02	-0.05	±0
	Max. +0.03	+0.02	+0.05
Vac hardened from 1020°C (1870°F)	Min. +0.01	-0.02	+0.08
	Max. +0.02	-0.04	+0.12

Dimensional changes during tempering

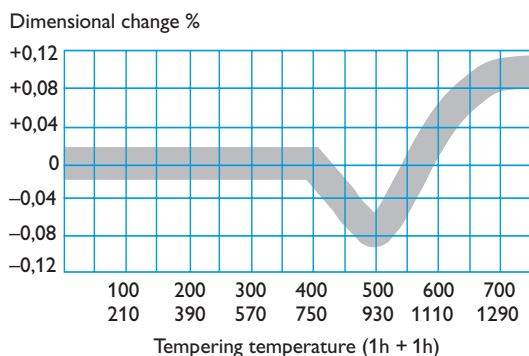

Note: The dimensional changes in hardening and tempering should be added.

Nitriding and nitrocarburizing

Nitriding and nitrocarburizing result in a hard surface layer which is very resistant to wear and erosion. The nitrided layer is, however, brittle and may crack or spall when exposed to mechanical or thermal shock, the risk increasing with layer thickness. Before nitriding, the tool should be hardened and tempered at a temperature at least 25–50°C (45–90°F) above the nitriding temperature.

Nitriding in ammonia gas at 510°C (950°F) or plasma nitriding in a 75% hydrogen/25% nitrogen mixture at 480°C (895°F) both result in a surface hardness of about 1100 HV_{0.2}. In general, plasma nitriding is the preferred method because of better control over nitrogen potential; in particular, formation of the so-called white layer, which is not recommended for hot-work service, can readily be avoided. However, careful gas nitriding can give perfectly acceptable results.

Uddeholm Orvar Supreme can also be nitrocarburized in either gas or salt bath.

The surface hardness after nitrocarburizing is 900–1000 HV_{0.2}.

DEPTH OF NITRIDING

Process	Time	Depth	
		mm	inch
Gas nitriding at 510°C (950°F)	10 h	0.12	0.0047
	30 h	0.20	0.0079
Plasma nitriding at 480°C (895°F)	10 h	0.12	0.0047
	30 h	0.18	0.0071
Nitrocarburizing – in gas at 580°C (1075°F)	2.5 h	0.11	0.0043
		0.06	0.0024
Nitrocarburizing – in salt bath at 580°C (1075°F)	1 h	0.06	0.0024

Nitriding to case depths >0.3 mm (>0.012 inch) is not recommended for hot work applications.

Uddeholm Orvar Supreme can be nitrided in the soft-annealed condition. The hardness and depth of case will, however, be reduced somewhat in this case.

Machining recommendations

The cutting data below are to be considered as guiding values, which must be adapted to existing local conditions.

More information can be found in the Uddeholm publication "Cutting data recommendation".

Turning

Cutting data parameters	Turning with carbide		Turning with high speed steel
	Rough turning	Fine turning	Fine turning
Cutting speed (v_c) m/min f.p.m.	200–250 660–820	250–300 820–985	25–30 82–100
Feed (f) mm/r i.p.r.	0.2–0.4 0.008–0.016	0.05–0.2 0.002–0.008	0.05–0.3 0.002–0.012
Depth of cut (a_p) mm inch	2–4 0.08–0.16	0.5–2 0.02–0.08	0.5–2 0.02–0.08
Carbide designation ISO	P20–P30 Coated carbide	P10 Coated carbide or cermet	–

Drilling

HIGH SPEED STEEL TWIST DRILL

Drill diameter		Cutting speed, v_c		Feed, f	
mm	inch	m/min	f.p.m.	mm/r	i.p.r.
– 5	–3/16	16–18*	52–59*	0.05–0.15	0.002–0.006
5–10	3/16–3/8	16–18*	52–59*	0.15–0.20	0.006–0.008
10–15	3/8–5/8	16–18*	52–59*	0.20–0.25	0.008–0.010
15–20	5/8–3/4	16–18*	52–59*	0.25–0.35	0.010–0.014

* For coated high speed steel drill $v_c = 28–30$ m/min (92–98 f.p.m.)

CARBIDE DRILL

Cutting data parameters	Type of drill		
	Indexable insert	Solid carbide	Carbide tip ¹⁾
Cutting speed (v_c) m/min f.p.m.	220–240 720–785	130–160 425–525	80–110 260–360
Feed (f) mm/r i.p.r.	0.03–0.12 ²⁾ 0.001–0.005 ²⁾	0.08–0.20 ³⁾ 0.003–0.008 ³⁾	0.15–0.25 ⁴⁾ 0.006–0.010 ⁴⁾

¹⁾ Drill with replaceable or brazed carbide tip

²⁾ Feed rate for drill diameter 20–40 mm (0.8"–1.6")

³⁾ Feed rate for drill diameter 5–20 mm (0.2"–0.8")

⁴⁾ Feed rate for drill diameter 10–20 mm (0.4"–0.8")

Milling

FACE AND SQUARE SHOULDER MILLING

Cutting data parameters	Milling with carbide	
	Rough milling	Fine milling
Cutting speed (v_c) m/min f.p.m.	180–260 590–850	260–300 850–985
Feed (f_z) mm/tooth inch/tooth	0.2–0.4 0.008–0.016	0.1–0.2 0.004–0.008
Depth of cut (a_p) mm inch	2–5 0.08–0.20	–2 –0.08
Carbide designation ISO	P20–P40 Coated carbide	P10–P20 Coated carbide or cermet

END MILLING

Cutting data parameters	Type of end mill		
	Solid carbide	Carbide indexable insert	High speed steel
Cutting speed (v_c) m/min f.p.m.	160–200 525–660	170–230 560–755	35–40 ¹⁾ 115–130 ¹⁾
Feed (f_z) mm/tooth inch/tooth	0.03–0.20 ²⁾ 0.001–0.008 ²⁾	0.08–0.20 ²⁾ 0.003–0.008 ²⁾	0.05–0.35 ²⁾ 0.002–0.014 ²⁾
Carbide designation ISO	–	P20, P30	–

¹⁾ For coated high speed steel end mill $v_c = 55–60$ m/min (180–195 f.p.m.)

²⁾ Depending on radial depth of cut and cutter diameter

Grinding

A general grinding wheel recommendation is given below. More information can be found in the Uddeholm brochure "Grinding of Tool Steel" and can also be obtained from the grinding wheel manufacturer.

WHEEL RECOMMENDATION


Type of grinding	Soft annealed condition	Hardened condition
Face grinding straight wheel	A 46 HV	A 46 HV
Face grinding segments	A 24 GV	A 36 GV
Cylindrical grinding	A 46 LV	A 60 KV
Internal grinding	A 46 JV	A 60 IV
Profile grinding	A 100 KV	A 120 KV

Welding

Welding of tool steel can be performed with good results if proper precautions are taken regarding elevated temperature, joint preparation, choice of consumables and welding procedure.

Welding method	TIG	MMA
Working temperature	325–375°C 620–710°F	325–375°C 620–710°F
Filler metal	QRO 90 TIG-WELD DIEVAR TIG-WELD	QRO 90 WELD
Cooling rate	20–40°C/h (40–70°F/h) the first 2–3 h then freely in air.	
Hardness after welding	50–55 HRC	50–55 HRC
<i>Heat treatment after welding</i>		
Hardened condition	Temper at 10–20°C (20–40°F) below the original tempering temperature.	
Soft annealed condition	Soft-anneal the material at 850°C (1560°F) in protected atmosphere. Then cool in the furnace at 10°C (20°F) per hour to 650°C (1200°F) then freely in air.	

More detailed information can be found in the Uddeholm brochure “Welding of Tool Steel”.

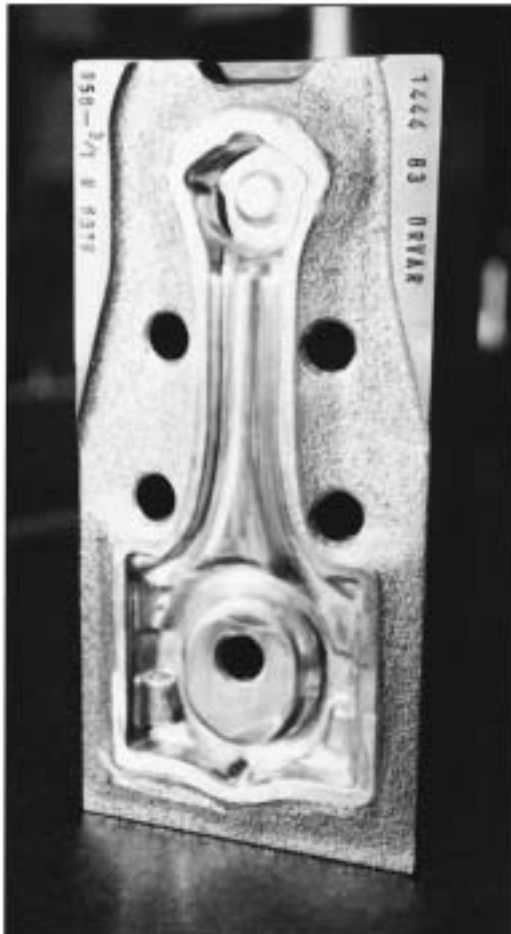

Electrical-discharge machining

If spark-erosion is performed in the hardened and tempered condition, the white re-cast layer should be removed mechanically e.g. by grinding or stoning. The tool should then be given an additional temper at approx. 25°C (50°F) below the previous tempering temperature.

Hard-chromium plating

After plating, parts should be tempered at 180°C (360°F) for 4 hours within 4 hours of plating to avoid the risk of hydrogen embrittlement.

Polishing

Uddeholm Orvar Supreme exhibits good polishability in the hardened and tempered condition. Polishing after grinding can be effected using aluminium oxide or diamond paste.

Typical procedure:


1. Rough grinding to 180–320 grain size using a wheel or stone.
2. Fine grinding with abrasive paper or powder down to 400–800 grain size.
3. Polish with diamond paste grade 15 (15µm grain size) using a polishing tool of soft wood or fibre.
4. Polish with diamond paste 8–6–3 (8–6–3µm grain size) using a polishing tool of soft wood or fibre.
5. When demands on surface finish are high, grade 1 (1µm grain size) diamond paste can be used for final polishing with a fibre polishing pad.

Photo-etching

Uddeholm Orvar Supreme is particularly suitable for texturing by the photo-etching method. Its high level of homogeneity and low sulphur content ensures accurate and consistent pattern reproduction.

Further information

Please contact your local Uddeholm office for further information on the selection, heat treatment, application and availability of Uddeholm tool steel.

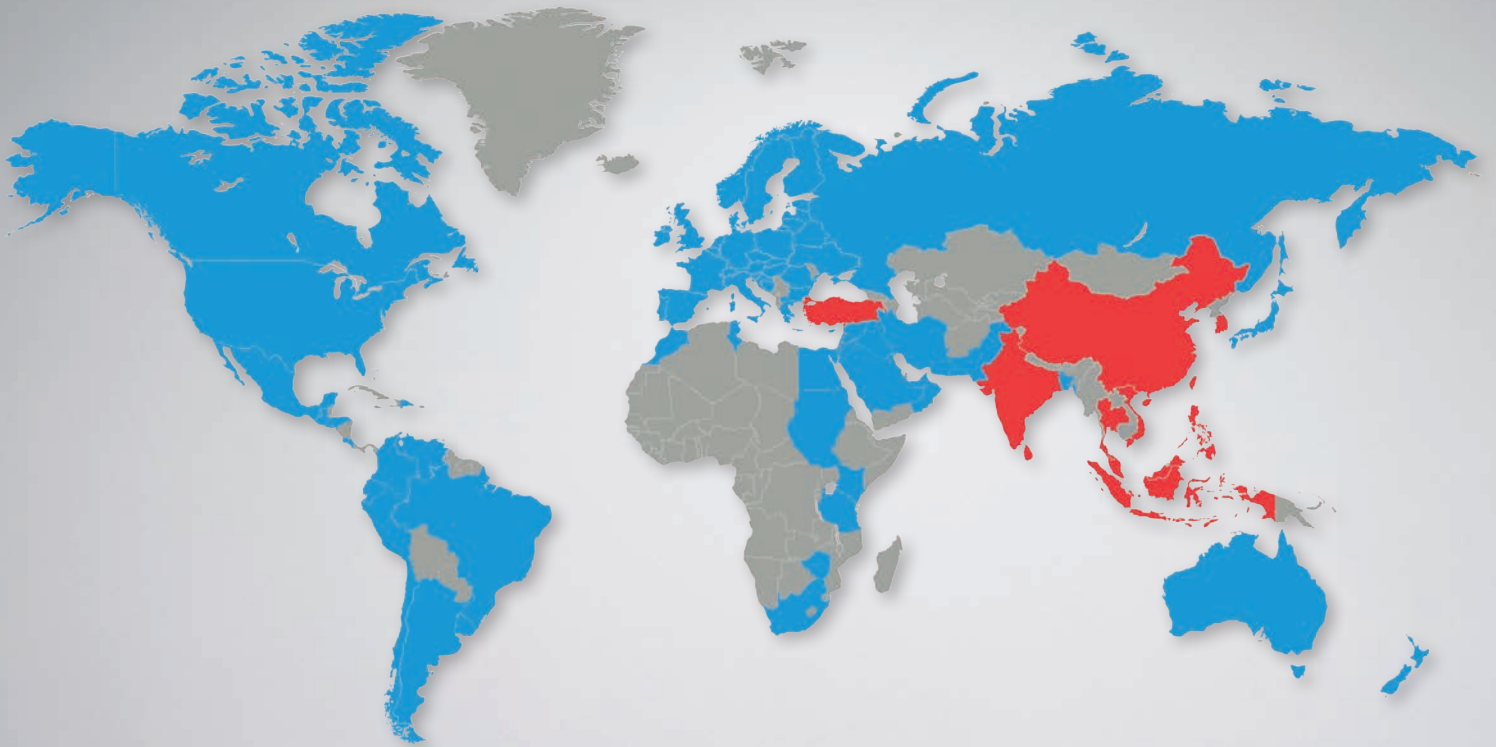

Network of excellence

UDDEHOLM is present on every continent. This ensures you high-quality Swedish tool steel and local support wherever you are. ASSAB is our wholly-owned subsidiary and exclusive sales channel, representing Uddeholm in various parts of the world. Together we secure our position as the world's leading supplier of tooling materials.

UDDEHOLM is the world's leading supplier of tooling materials. This is a position we have reached by improving our customers' everyday business. Long tradition combined with research and product development equips Uddeholm to solve any tooling problem that may arise. It is a challenging process, but the goal is clear – to be your number one partner and tool steel provider.

Our presence on every continent guarantees you the same high quality wherever you are. ASSAB is our wholly-owned subsidiary and exclusive sales channel, representing Uddeholm in various parts of the world. Together we secure our position as the world's leading supplier of tooling materials. We act worldwide, so there is always an Uddeholm or ASSAB representative close at hand to give local advice and support. For us it is all a matter of trust – in long-term partnerships as well as in developing new products. Trust is something you earn, every day.

For more information, please visit www.uddeholm.com, www.assab.com or your local website.

UD
WOR
RUST IS SOM
TRUST IS
AUTOMOTIVE
KNOWLEDGE SU
TOUGHNESS STR
MATERIALS
EDDING WATER
BYSTANDIN
RESULTS. IN
CUSTOMER B
BILITY TRUST IS
AUTOMOTIVE
LEADING SU
INNOVATION
STRENGTH INNOVATION
WORLDWIDE PRE
SOMETHING YO
PROBLEM
THE WORL
NOMY THE
DUCTILITY TO
COMMITMENT PART
KNOWLEDGE UN
KNOWLEDGE
RELIABILITY
OF EXCEL
AUTOMOTIVE A
ECONOMY THE
TOTAL ECONOMY
DUCTILITY TOUGHNE
HARDNESS WORLDW
TRUST IS SOMETH
UNDERSTANDING MACHIN
RESULTS. SOLVING PROB
ECONOMY THE WORL
STRENGTH IN
TOUGHNESS STRENGTH I
MATERIALS PARTN
UNDERSTANDING MACHIN
BILITY RELIABILITY RESU
LASTING TOOLS TOTAL
YOU EARN, EVERY DAY. LO
OF THINKING HIGH PE
OFTOOLING MATERIALS C
INNOVATION KNOWLEDGE
STRENGTH INNOVATION KNOW
REFERENCE. LONG DURABILITY
TRUST IS SOMETHING YOU EARN,
PROBLEMS AUTOMOTIVE